# PROCESS HEATING APPLICATION **EXAMPLES**

#### **EXAMPLE 1: HEATING LIQUID IN A TANK**

Description: An open steel tank, 3 ft. wide, 4 ft. long, 3 ft. deep and weighing 350lb., is filled with water to within 9 inches of the top. Bottom and sides have 4 inches of insulation. Water is to be heated from 50°F to 175°F within 1 hour and, from then on, approximately 12 gallons per hour will be drawn off and replaced.

## Calculation of wattage required:

#### Considerations:

Beginning to final temperature: 50-175°F Time available for Process Start-Up: 1 hour

Process cycle period: 1 hour

Weight and thermal properties of all materials:

Specific heat of steel: 0.12 Btu/lb./°F Specific heat of water: 1.0 Btu/lb./°F

Density of water: 62.5 lb./cu.ft. or 8.3 lb./gal. Weight of water in tank: (3 x 4 x 2.25) cu.ft.

x 62.5 lb./cu.ft. = 1688 lb.

Weight of additional water added during process:

 $12 \text{ gal./hr.} \times 8.34 \text{ lb./gal.} = 100 \text{ lb.}$ 

Weight of tank: 350 lb.

Exposed surface areas and heat losses:

Amount of insulation: 4"

Water surface area: 12 sq.ft.

Tank vertical surface area: 42 sq.ft.

Tank bottom surface area: 12 sq.ft.

From graph 4T, heat losses from the water surface: At 175°F-750 watts/sq.ft.

From graph 1T, heat losses from the insulated surfaces: At 175°F—8 watts/sq.ft. (bottom surface — 4 watts/ sq.ft.)

## STEP 1: Wattage Required for Process Start-Up

To heat tank:

Qha + Qls + CF	= kwh
kwh	= kw
Hours allowed for process start-up	- VAA

## A. Qha

350lb. x 0.12 Btu/lb./°F x (175–50) °F	= 1.54kwh
3412 Btu/kwh	- 1.548911
	+
To heat water: 1688 lb. x 1.0 Btu/lb./°F x (175-50) °F	
3412 Btu/kwh	= 61.84kwh
	+
Heat of fusion or vaporization	= NONE
	= 63.38kwh

B. Qls		
Average loss from water surface:		
12 sq.ft. x 750 w/sq. ft. x 1 hr. x ½	=	4.5kwh
1000 w/kw		
		+

Average loss from tank vertical surface:


$$\frac{42 \text{ sq.ft. x 8 w/sq. ft. x 1 hr.}}{1000 \text{ w/kw}} \text{ x } \frac{1}{2} = 0.17 \text{ kwh}$$

Average loss from tank bottom surface:

$$\frac{12 \text{ sq.ft. x 4 w/sq. ft. x 1 hr}}{1000 \text{ w/kw}} \text{ x } \frac{1}{2} = 0.02 \text{kwh}$$



4.69kwh

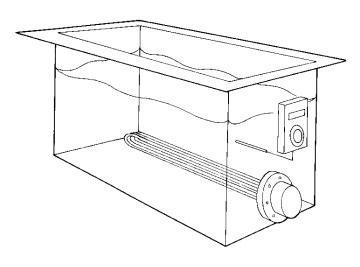

C. CF

$$20\% (63.38 + 4.69) = 13.61kwh$$

# Wattage Required for Process Start-up:

$$\frac{63.38 + 4.69 + 13.61}{1 \text{ hour}} = 81.68 \text{kwh}$$

# STEP 2: Wattage Required for Process Operation

Ωha2	+ Ols2	+ CF	=	kw

D. Qha2

To heat additional water: 100 lb. x 1.0 Btu/lb./°F x (175-50) °F = 3.66kwh 3412 Btu/kwh

Heat of fusion or vaporization = NONE 3.66kwh

E. Qls2

Loss from water surface: 12 sq.ft. x 750w/sq.ft. 9.0kwh 1000w/kw

Loss from tank vertical surface:

42sq.ft. x 8w/sq.ft. 0.34kwh 1000w/kw

Loss from tank bottom surface:

12sq.ft. x 4w/sq.ft. = 0.05 kwh1000w/kw 9.39kwh

F. CF

$$20\%(3.66 + 9.39) = 2.61kwh$$

## Wattage Required for Process Operation:

$$3.66 + 9.39 + 2.61 = 15.66$$
kw


In this application, with a significant difference between the wattage necessary for start-up versus operation, it is recommended to lengthen the time to initially bring the process to the required temperature. By allowing 7 hours for initial heat-up, the wattage required would drop to 18.36 kw. The time variable in QIs would be changed to 7 hrs. and the averaging figure to %. However, during startup, by placing a cover with 4" insulation over the top

surface, 16 kw would bring the process to temperature in less than 4 hours.

It is necessary to know the condition of the water. If the water is reasonably clean, a copper sheath immersion heater would be adequate, because corrosion of the elements would not be a consideration. As heat is transferred well from the element in the direct immersion heating of water, a watt density up to 60 watts per square inch would be acceptable. If any doubt exists about the process conditions, more research would be necessary.

As this process would not seem to require accurate temperature control, a D1 thermostat would most likely be adequate. Accuracy improvement would be accomplished with electronic controls such as the ETR-404. Careful design of the thermal system would lead to satisfactory process results.

#### **EXAMPLE 2: CHANGING THE STATE OF A** MATERIAL

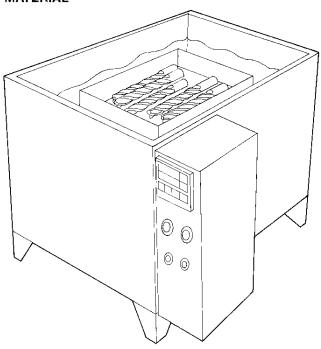

Description: An open, uninsulated tank, 11/2 ft. wide, 2 ft. long, 1½ ft. deep and weighing 140 lbs., will contain 168 lbs. of paraffin. The manufacturer of steel drills must apply a coating of paraffin as protection prior to shipping. The paraffin needs to be heated from 70-150°F in 3 hours. The steel drills, each weighing .157 lb., are to be placed in a 5 lb. rack and dipped in the melted paraffin. 100 drills will be processed each cycle, 1500 per hour. Each cycle is 4 minutes, 20 additional pounds of paraffin will be required each hour.

# Calculation of wattage required:

#### Considerations:

Beginning to final temperature: 70-150°F Time available for process start-up: 3 hours

Process cycle period: 1 hour

Weight and thermal properties of all materials:

Specific heat of steel: 0.12 Btu/lb./°F

Specific heat of solid paraffin:

0.70 Btu/lb./°F

Melting point of paraffin: 133°F Heat of fusion of paraffin: 63 Btu/lb.

Specific heat of melted paraffin:

0.71 Btu/lb./°F

Weight of tank: 140 lbs

Weight of rack: 5 lbs. each (75 lbs. total for

15 cycles/hour)

Weight of drills: .157 lb. each-1500/hr.

(235.5 lbs. total/hr.) Weight of paraffin: 168 lbs.

Weight of paraffin added during process: 20 lbs.

Exposed surface areas and heat losses:

Amount of insulation: none

Paraffin surface area: 3 sq. ft.

Tank vertical surface area: 10.5 sq. ft.

Tank bottom surface area: 3 sq. ft.

From graph 3T, heat losses from paraffin surface:

At 150°F-70 watts/sq. ft.

From graph 1T, heat losses from uninsulated tank

surface: At 150°F-55 watts/sq. ft. (bottom surface—27 watts/sq.ft.)

STEP 1: Wattage Required for Process S	tart-	Up	STEP 2: Wattage Required for Process Op	era	ation
Qha + Qls + CF	=	kwh	Qha2 + Qls2 + CF	=	kw
kwh			D. Qha2		
Hours allowed for process start-up	=	kw	To heat drills and racks:		
A. Qha			(235.5 + 75)lbs. x 0.12 Btu/lb./°F x (150-70) °F 3412 Btu/kwh	=	0.87kwh
To heat tank: 140 lb. x 0.12 Btu/lb./°F x (150-70) °F 3412 Btu/kwh	=	0.39kwh +	To heat solid paraffin added during process: 20 lbs. x 0.70 Btu/lb./°F x (133-70) °F 3412 Btu/kwh	=	+ 0.26kwh
To heat solid paraffin:			3412 Blu/KWII		+
168 lb. x 0.70 Btu/lb./°F x (133-70) °F 3412 Btu/kwh	=	2.17kwh +	To heat melted paraffin added during process: 20 lbs. x 0.71 Btu/lb./°F x (150-133) °F 3412 Btu/kwh	: =	0.07kwh
To heat melted paraffin: 168 lb. x 0.71 Btu/lb./°F x (150-133) °F					+
3412 Btu/kwh	=	0.59kwh +	Heat of fusion to melt additional paraffin:  20 lbs. x 63 Btu/lb.  3412 Btu/kwh	=	0.37kwh
Heat of fusion to melt paraffin: 168 lb. x 63 Btu/lb. 3412 Btu/kwh	=	3.10kwh		=	1.57kwh
C / IZ BKG/KWII			E. Qls2		
	=	6.25kwh	Loss from paraffin surface: <u>3 sq.ft. x 70 w/sq.ft.</u> 1000 w/kw	=	0.21kwh
B. Qls					+
Average loss from paraffin surface: 3 sq.ft. x 70 w/sq.ft. x 3 hrs. x 3/3 1000 w/kw	=	0.42kwh +	Loss from tank vertical surface:  10.5 sq.ft. x 55 w/sq.ft.  1000 w/kw	=	0.58kwh +
Average loss from tank vertical surface: 10.5 sq.ft. x 55 w/sq.ft. x 3 hrs. x 3/3 1000 w/kw	=	1.16kwh	Loss from tank bottom surface:  3 sq.ft. x 27 w/sq.ft.  1000 w/kw	=	0.08kwh
		+		_	0.87kwh
Average loss from tank bottom surface:  3 sq.ft. x 27 w/sq.ft. x 3 hrs. x 3/4  1000 w/kw	=	0.16kwh	G. CF	-	
1000 WINW			20%(1.57 + 0.87)	= .	0.49kwh
	=	1.74kwh	Wattage Required for Process Operation:		
C. CF			1.57 + .87 + .49	_	2.93kw
20% (6.25 + 1.74)	=	1.60kwh	The results of this particular example were tha	: at t	he start-

= 3.20kw


Wattage Required for Process Start-Up:

6.25 + 1.74 + 1.60

3 hours

The results of this particular example were that the startup and operating wattage requirement were nearly identical. 3.2 kw will be the power installed. As can be seen from 23T, the watt density cannot exceed 16 watts/sq.in. in heating paraffin. As immersion heating is not reasonable, the best heat source would be HD Strip Heaters mounted on the tank bottom. This will provide efficient conductive and convective heat transfer. Accurate temperature control is required as the process is near to the maximum operating temperature of this material, 150°F, which is also found on 23T. A PID control such as an ETR-9090 would be the best selection. The placement of the thermal system components as described will lead to satisfactory process results.

#### **EXAMPLE 3: SURFACE HEATING**

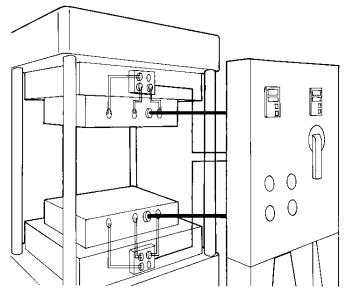

Description: A press has two steel platens, each 3ft. X 8ft. X 3" thick. After initial heat-up from 70°F to 350°F in 2 hours, 60 lb. sheets of fiberboard are processed by drying and compressing to 1/4 inch thickness at a rate of 3 per hour. Platens are closed during initial heat-up and open for 2 minutes of the 20 minute working cycle. The horizontal non-working surfaces of the platens are insulated from the press, but the edges are exposed.

# Calculation of wattage required:

#### Considerations:

Beginning to final temperature: 70-350 °F Time available for process start-up: 2 hours Process cycle period: 20 minutes each sheet 3 sheets per hour

Weight and thermal properties of all materials:

Specific heat of steel: 0.12 Btu/lb./°F Specific heat of fiberboard: 0.65 Btu/lb./°F

Density of steel: 491 lb./cu.ft.

Weight of platens: 2(3X8X.25) cu.ft. X 491lb./cu.ft. = 5892 lb.

Weight of fiberboard: 60 lbs. each sheet 180 lbs. per hour

Exposed surface areas and heat losses:

Amount of insulation:

No insulation on sides

Negligible losses from insulated horizontal surfaces

Exposed platen side area: 11 sq.ft.

Exposed platen open area: 48 sq.ft.

From graph 1T, heat losses from uninsulated metal surfaces:

At 350°F-275 watts/sq. ft.

# STEP 1: Wattage Required for Process Start-Up

$$\frac{\text{Qha + Qls + CF}}{\text{kwh}} = \text{kw}$$
Hours allowed for process start-up}

#### A. Qha

To heat platens 5892 lb. x 0.12 Btu/lb./°F x (350-70) °F = 58.02kwh3412 Btu/kwh

Heat of fusion or vaporization: = None

= 58.02kwh

#### B. QIs

Average loss from uninsulated side areas: 11 sq. ft. x 275 w/sq.ft. x 2 hr. x ½ 3.02kwh

1000 w/kw

3.02kwh

C. CF

20%(58.02 + 3.02)= 12.21kwh

## Wattage Required for Process Start-Up:

$$\frac{58.02 + 3.02 + 12.21}{2 \text{ hours}} = \frac{36.62 \text{kw}}{}$$

# STEP 2: Wattage required for process operation

Qha2 + Qls2 + CF kw

D. Qha2

To heat fiberboard: 60 lb. x 0.65 Btu/lb./°F x (350-70) °F 3.20kwh 3412 Btu/kwh

Heat of fusion or vaporization: = None

3.20kwh

#### E. Qls2

Loss from uninsulated side areas: 11 sq.ft. x 275 w/sq.ft. x 0.33 hr. 1.00kwh 1000 w/kw

Loss from open platen: 48 sq.ft. x 275 w/sq.ft. x 0.33 hr. 4.36kwh 1000 w/kw

5.36kwh

F. CF

20%(3.20 + 5.36)1.71kwh

Wattage required for each 20 minute cycle: 3.20 + 5.36 + 1.71


= 10.27 kwh

# Wattage Required for Process Operation:

As the start-up and operating requirements are close, 36.62kw will be installed.

This system is a large thermal mass with control accuracy requirements at a minimum because of the non-critical temperatures of the process in relation to the product. HD Strip Heaters or tubular heaters in milled slots or cartridge or tubular heaters in drilled holes would be acceptable heat sources for this application. Both the top and bottom platens would be sensed and if greater accuracy was desired, each platen could be zoned.

#### **EXAMPLE 4: PROCESS AIR HEATING**

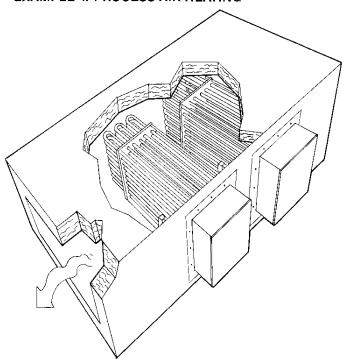

**Description:** A drying process requires 2500 cubic feet of air per minute at 275°F. Incoming air temperature has already been heated to 200°F along the way. The air will need to travel an additional 10 feet from the heater exhaust to the process. Dimensions of the duct are 24" wide x 24" high and is covered with 2" of insulation. There is no recirculation of the air. As this is a continuous process, start-up calculations are not required.

# Calculation of wattage required:

## Considerations:

Beginning to final temperature: 200–275°F Duct opening: 2 ft. x 2 ft.

Weight and thermal properties of all materials: From 10T, average specific heat of air: specific heat at 200°F = 0.242 Btu/lb./°F

specific heat at  $200^{\circ}F = 0.242 \text{ Btu/lb./}^{\circ}F$ specific heat at  $275^{\circ}F = 0.243 \text{ Btu/lb./}^{\circ}F$ 

Average = 
$$\frac{.242 + .243}{2}$$
  
= .2425 Btu/lb./°F

From 10T, density of air at 200°F: 0.060 lb./cu.ft. From 10T, density of air at 275°F: 0.054 lb./cu.ft.

Weight of air processed per hour: 2500 cfm x 0.060 lb./cu.ft. x 60 min./hr. = 9000 lbs.

Exposed surface areas and heat losses:

Amount of insulation: 2"

Surface area of duct: 80 sq.ft.

From graph 2T, heat losses from insulated surfaces at 275°F: 5 watts/sg.ft.

## STEP 2: Wattage Required for Process Operation

Qha2 + Qls2 + CF = kwh

D. Qha2

To heat air:  $\frac{9000 \text{ lbs. x } 0.2425 \text{ Btu/lb.}/^{\circ}\text{F x } (275-200) ^{\circ}\text{F}}{3412 \text{ Btu/kwh}} = 47.97 \text{kwh}$ 

= 47.97kwh

#### E. QIs2

Losses from insulated duct surface:

80 sq.ft. x 5 w/sq.ft. x 1 hr.
1000 w/kw

= 0.40kwh

= 0.40kwh

F. CF

20%(47.97 + 0.40) = 9.67kwh

## Wattage Required for Process Operation:

$$47.97 + 0.40 + 9.67 = 58.04kw$$

To select the appropriate heater as to the type and watt density, it is necessary to determine the outlet velocity. Each OGDEN Process Air Heater has maximum outlet air temperatures based upon the air velocity. Air and other gases' molecules move further apart as heating occurs, causing the density to decrease (become lighter) as the temperature increases. Because the area the gas passes through in a duct heater is constant, the velocity increases. It is important to note that the difference between the inlet velocity and density and the outlet velocity and density could be significant based upon the temperature differential of the two. See 50T. If air velocity versus outlet air temperature is not within catalog guidelines, element overheating and failure will occur.

To determine the Outlet Velocity:

To determine the Inlet Velocity:

Inlet Velocity (fpm<sub>1</sub>) = 
$$\frac{\text{cfm}}{\text{Duct Opening (sq. ft.)}}$$

From Example 4:

Inlet Velocity (fpm<sub>1</sub>) =

$$2 \times 2$$
= 625 fpm

Outlet
Velocity (fpm<sub>2</sub>)
$$= 625 \text{ fpm x} \frac{2500 \text{ cfm x } 0.060 \text{ lb./cu.ft.}}{2500 \text{ cfm x } 0.054 \text{ lb./cu.ft.}}$$


$$= 625 \text{ fpm x } \frac{150}{135}$$

$$= 694.4 \text{ fpm}$$

fps 
$$= \frac{695 \text{ fpm}}{60 \text{ sec/min}}$$
fps 
$$= 11.57$$

Based upon the requirement of 58.04 kw and that the outlet velocity versus the outlet temperature is well within the limitations of the ODH Process Air Heaters as shown in that catalog section, a proper selection would be the ODH-60. In further checking, a tubular heater at 22 watts per square inch operating in distributed air of 9 fps would be producing less than 1000°F sheath temperature per Chart 15T. As this process is over 11 fps, element temperature will never be a problem as long as this velocity exists. To be certain, a type K thermocouple will be attached to an element to provide input to a limit control. The process sensor should be mounted down-stream from the heater to be certain the temperature is 275°F at the process. An ETR Temperature Control will provide satisfactory process control.

# **EXAMPLE 5: OVEN HEATING**

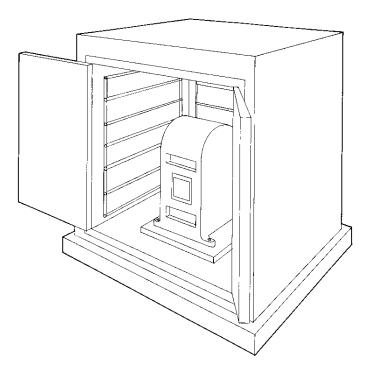

Description: An oven with inside dimensions of 4 ft. wide. 2 ft. deep and 2 ft. high, weighs 800 lbs., contains a 35 lb. steel tray and is covered with 2 inches of cerafelt insulation weighing 15.5 lbs. After being heated from 60 to 250°F in 1 hour, one 75 lb. motor will be dried every 15 minutes. After start-up, air is vented at the rate of 2 complete changes per cycle. It can be assumed that there are 2 lbs. of water in each motor.

## Calculation of wattage required:

# Considerations:

Beginning to final temperature: 60-250°F Time available for process start-up: 1 hour Process cycle period: 15 minutes each motor 4 motors per hour

Weight and thermal properties of all materials:

Specific heat of steel: 0.12 Btu/lb./°F

Weight of oven: 800 lbs.

Weight of motor: 75 lbs.

Weight of tray: 35 lbs.

Specific heat of cerafelt insulation: 0.25 Btu/lb./°F

Weight of cerafelt insulation: 15.5 lbs.

Specific heat of air: 0.237 Btu/lb./°F

Density of air: 0.08 lb./cu.ft.

Weight of air in oven  $(4 \times 2 \times 2) \times 0.08$  lb./cu. ft. = 1.28lb.

Specific heat of water: 1.0 Btu/lb./°F

Heat of vaporization of water: 965 Btu/lb.

Weight of water present each cycle: 2 lbs.

Exposed surface areas and heat losses:

Amount of insulation: 2"

Oven vertical and top surface area: 32 sq.ft.

Oven bottom surface area: 8 sq.ft.

From graph 2T, heat losses from the insulated

surfaces at 250°F: 8 watts/sq. ft. (Bottom surface

= 4 watts/sq.ft.)

## STEP 1: Wattage Required for Process Start-Up

Qha + Qls + CF	=	kwh
kwh	_	kw
Hours allowed for process start-up	_	IV AA

#### A. Qha

To heat oven: 800 lb. x 0.12 Btu/lb./°F x (250-60) °F 3412 Btu/kwh	=	5.34kwh +
To heat tray: 35 lb. x 0.12 Btu/lb./°F x (250-60) °F 3412 Btu/kwh	Ξ	0.23kwh +
To heat air: 1.28 lb. x 0.237 Btu/lb./°F x (250-60) °F 3412 Btu/kwh	=	0.02kwh

To heat insulation: 15.5 lb. x 0.25 Btu/lb./°F x (250-60) °F 3412 Btu/kwh

0.22kwh

Heat of fusion or vaporization:

5.81kwh

= None

## B. QIs

Average loss from insulated vertical and top oven surfaces:

32 sq.ft. x 8 w/sq.ft. x 1 hr. 0.13kwh 1000 w/kw

Average loss from insulated bottom oven surface:

8 sq.ft. x 4 sq/sq.ft. x 1 hr. x ½ 0.02kwh 1000 w/kw

0.15kwh

C. CF

30% (5.81 + 0.15) = 1.79kwh

Wattage Required for Process Start-Up:

5.81 + .15 + 1.797.75kw 1 hour

# STEP 2: Wattage Required for Process Operation

Qha2 + Qls2 + CF kw

D. Qha2

To heat motor: 75 lb. x .12 Btu/lb./°F x (250-60) °F 0.50kwh 3412 Btu/kwh

To heat air:

(2)1.28 lb. x 0.237 Btu/lb./°F x (250-60) °F 0.03kwh 3412 Btu/kwh

+

To heat water: 2 lb. x 1 Btu/lb./°F x (212-60) °F

3412 btu/kwh

0.09kwh +

Heat of vaporization to evaporate water:

2 lb. x 965 Btu/lb. 3412 Btu/kwh

0.56kwh

= 1.18kwh

#### E. Qls2

Loss from insulated vertical and top oven surfaces: 32 sq.ft. x 8 w/sq.ft. x .25 hrs.

0.06kwh 1000 w/kw

Loss from insulated bottom oven surface:

$$\frac{8 \text{ sq.ft. x 4 w/sq.ft. x .25 hrs.}}{1000 \text{ w/kw}} = 0.01 \text{kwh}$$

0.07kwh

F. CF

30% (1.18 + 0.07) 0.38kwh

Wattage required for each 15 minute cycle:

$$1.18 + 0.07 + 0.38 = 1.63$$
kwh


## Wattage Required for Process Operation:

= 6.52kw

As can be seen, a 30% contingency factor was utilized in this process. Additional heat losses will likely occur as the oven doors are frequently opened. As the wattage requirement for the start-up is greater than the operating requirement, 7.75kw will be installed. The extra wattage can be considered an additional safety measure. Either tubular heaters or HD Strip Heaters mounted to the oven wall would be acceptable. A time proportioning ETR Temperature Control with an exposed junction type J thermocouple would provide the proper control.

## DETERMINING WATT DENSITY

#### **IMMERSION HEATERS:**

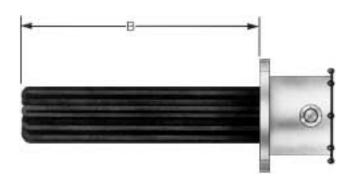

B dim. = 
$$\frac{EHL}{\text{#elements x 2}}$$
 + cold area

element dia. x EHL x π

EHL = (# elements x 2 x B) - (cold area x # elements x 2)

$$EHL = \frac{Wattage}{element dia. \times w/sq.in. \times \pi}$$

$$Watt Density = \frac{Wattage}{(w/sq.in.)}$$

$$= \frac{element dia. \times EHL. \times EHL.}{element dia. \times EHL.}$$

## To determine the watt density when kw and immersion depth (B dim.) are known:

Assume-25kw

B = 30''(6 cold area)

6" Flanged Immersion Heater-18 elements

Find-Watt density

 $EHL = (18 \times 2 \times 30) - (6 \times 18 \times 2)$ 

EHL = 864"

25000 Watt density = -.475 x 864 x π

Watt density = 19.4 w/sq.in.

#### To determine immersion depth when kw and watt density limitations are known:

Assume-48kw

22w/sq.in.

8" Flanged Immersion Heater 24 elements (6" cold area)

Find—B dimension

EHL = 
$$\frac{48000}{.475 \times 22 \times \pi}$$

EHL = 1463"

$$B = \frac{1463}{(24 \times 2)} + 6$$

#### **ESTIMATING SHEATH WATT DENSITY FOR** OTHER PRODUCTS

# **BAND HEATERS:**

Watts/sq.in. = 
$$\frac{\text{Wattage}}{\text{(dia x } \pi \text{ x width)-width}}$$

See respective catalog section for each band heater for accurate watt density formulas.

#### CARTRIDGE AND TUBULAR HEATERS:

Watts/sq.in. = 
$$\frac{\text{Wattage}}{\text{dia. x heated length x } \pi}$$

## MICA STRIP HEATERS:

Watts/sq.in. = 
$$\frac{\text{Wattage}}{\text{(heated length x width)-width}}$$

#### **HD STRIP HEATERS:**

Watts/sq.in. = 
$$\frac{\text{Wattage}}{\text{heated length x 3.75}}$$

#### **CHANNEL HEATERS:**

Watts/sq.in. = 
$$\frac{\text{Wattage}}{\text{heated length x 3.625}}$$